

Please use the following information to troubleshoot the Driveri Hub-X.

Note. If you would like additional information about the Driveri Hub-X, please refer to the Driveri Hub-X FAQ.

General Notes

- Units manually paired in the Driveri Portal cannot be unpaired using the installer app.
- OTA upgrades are now being implemented.
 - o Upgrades only happen when the vehicle exceeds 30mph.
 - o The upgrade process will take approximately 1 minute.
 - o If RMA is required, please contact Support.

Hardware Checks

The Driveri Hub-X, when fully wired and connected, will power on with an ignition-on event. To determine if the Driveri Hub-X is on, look for the 4 LEDs on the panel opposite to the cable connections.



LED State & Description

The **PWR** and **SD** LEDs will glow green, and the ERR LED will blink red. This is normal operation.

Note. ERR Red LED indicates device is recording and working properly when blinking.

LED 1	ERR	Red - Blink	Connected to Wi-Fi network	
LED 2	NET	No glow	Reserved for future use	
LED 3	PWR	Green – Solid	Device Power ON indicator	
LED 4	SD	Green – Solid	SD card installed	
LED 5	IR	No glow	Reserved for installers – IR activity while using remote	



Hub-X Storage

Driveri Camera	Storage Hours (Standalone Driveri)	1 Ext Cam Storage (hr)	2 Ext Cam Storage (hr)	3 Ext Cam Storage (hr)	4 Ext Cam Storage (hr)
D-430 (128GB)	Up to 100	Up to 100	Up to 100	Up to 100	Up to 100
D-430 (256GB)	Up to 200	Up to 200	Up to 200	Up to 200	150
D-210 (128GB)	100	100	100	100	100
D-210 (256GB)	200	200	200	200	150
D-410 (128GB)	Up to 100	Up to 100	Up to 100	Up to 100	Up to 100
D-410 (512GB)	360	360	250	200	150

The storage information below is based on use of 720p external cameras.


Troubleshooting


Driveri Hub-X Won't Power On

- 1. Search for the burnt fuses inline with the power cables.
 - Red line contains a 10A fuse.
 - White line contains a 2A fuse.
- 2. Check with a multimeter.
 - Check the voltage out of circuit (utilizing the plug ground).
 - 12VDC on both sides, in circuit.
 - Molex on Driveri Hub-X.



Link: https://help.wextelematics.com/troubleshooting/driveri-hub-x-troubleshooting/ Last Updated: February 2nd, 2024

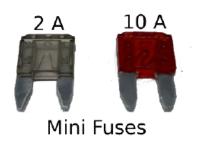

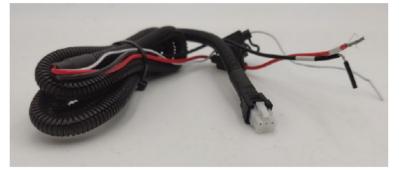

Only PWR LED is ON

- 1. For the device to operate the key must be in the locked position.
- 2. Next to the 4 LEDs, there is a keyhole. Check the position of this keyhole and verify that the indentation faces the "Locked" position.
- 3. SD Card LED should turn on and ERR LED should blink red shortly after the key is turned to the Lock state.

ERR Red LED indicates the device is recoriding and working properly when blinking.





Pitch Black or Corrupted Stream Feeds

- 1. Check the camera ports and secure the connections to the correct ports.
 - Ports must match IDMS configuration.
 - Check for proper seating, corrosion, or damage.
- 2. Configure the video feed resolutions in the Installer App corresponding to the camera ports and types.
 - You will see this warning every time you access a view on the Installer app, either you have the incorrect resolution setting or no camera attached.
- 3. Check video communication protocol NTSC(USA) vs PAL(Europe) settings.

Note. Only available on the Installer App.



Link: https://help.wextelematics.com/troubleshooting/driveri-hub-x-troubleshooting/ Last Updated: February 2nd, 2024

We are not receiving any video from Additional Camera 1. Please make sure camera is connected properly to DriveriHub and camera resolution or video standard is set correctly.

Locating Serial Number via Wi-Fi

If the identifying sticker is missing/unreadable/inaccessible, it can be found via Wi-Fi settings on your smart device.

- 1. Ensure the Driveri Hub-X has been powered ON, then turn on the Wi-Fi on your smart device.
- 2. On your smart device, navigate to **Settings**, then **Wi-Fi**.

You should see a network appear called "ftherXXXXXXXX". The numbers following "fther" is the serial number for the Driveri Hub-X device.


Note. If you see more than one "ftherXXXXXXXX" network appear then there are multiple Driveri Hub-Xs powered up nearby. Do not try to connect to the Wi-Fi of a different Driveri Hub-X device.



Edit


Gi

Link: https://help.wextelematics.com/troubleshooting/driveri-hub-x-troubleshooting/ Last Updated: February 2nd, 2024

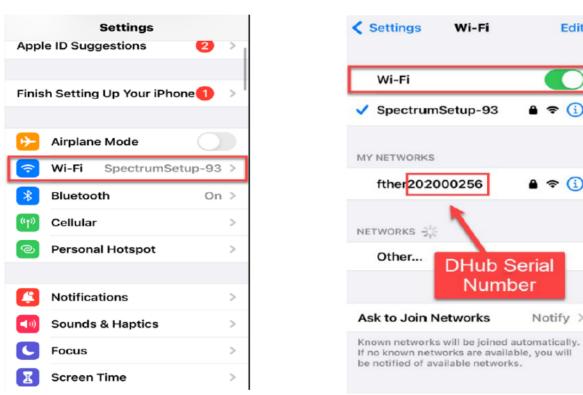

APPLE IOS

Android OS

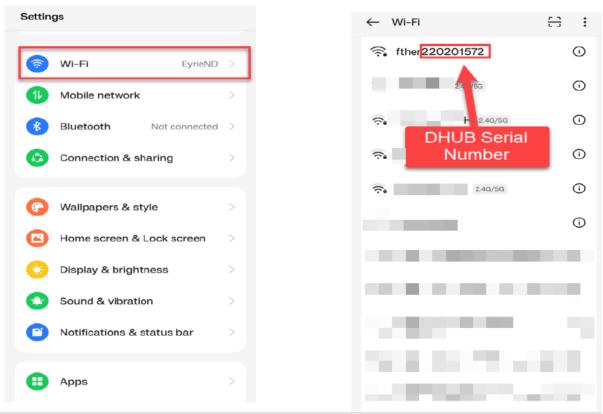



Difficulty Pairing the Driveri Hub-X with a Driveri Device

- 1. Ensure that the Driveri Hub-X's Wi-Fi antenna is connected and placed near the Driveri device and is not obstructed or blocked by any metallic surfaces.
- 2. Check the proximity of the Driveri device to the Driveri Hub-X, if the device is too far or the antenna can't reach the device, this can cause difficulty in retrieving videos.

In the example below the Driveri Hub-X Wi-Fi antenna has been located in close proximity to the Driveri device.



Needing to Change Resolution

If you need to change video resolution settings, please follow the below instructions.




- 1. In the Installer App, log in to the Driveri Hub-X and select **DriveriHub Settings**.
- 2. Select Video.
- 3. Check video communication protocol NTSC(USA) vs PAL(Europe) settings.
- 4. Under "Camera resolution combinations," select the desired resolution.

DriveriHub Cameras	Contracting University of Contracting States and update Driversity settings Contracted to Driversity 202001576	Video DriveriHub video settings
DriveriHub Settings	Video	Connected te DriveriHub : 220201576
Reboot DriveriHub	DateTime MM/DD/YY	Video Standard Please choose NTSC for USA and PAL for India
	SDCard Recording	O PAL
Disconnect from DriveriHub	OSD On screen display	NTSC
		Camera resolution combinations (D1 is the lowest resolution, equal to 480P)
		All channels set to D1
		4x720P All channels set to 720P
		All channels set to 1080P
		2x720P + 2xD1 CH1, CH2 - 720P and CH3, CH4 - D1
		2x1080P + 2xD1 CH1, CH2 - 1080P and CH3, CH4 - D1
		2x1080P + 2x720P CH1, CH2 - 1080P and CH3, CH4 - 720P

Driveri Hub-X Connectivity Outline



Link: https://help.wextelematics.com/troubleshooting/driveri-hub-x-troubleshooting/ Last Updated: February 2nd, 2024

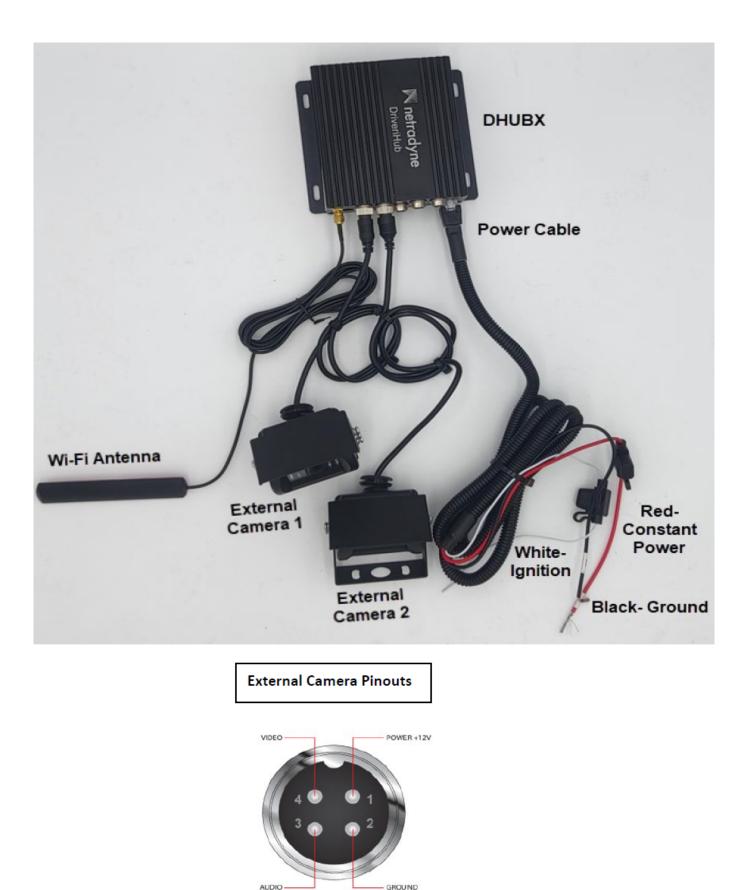



Link: https://help.wextelematics.com/troubleshooting/driveri-hub-x-troubleshooting/ Last Updated: February 2nd, 2024

Cable Connections





